

DEPARTMENT OF TRANSPORTATION**DIVISION OF ENGINEERING SERVICES**

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch

690 Walnut Ave.St. 150

Vallejo, CA 94592-1133

(707) 649-5453

(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 99.28**WELDING INSPECTION REPORT****Resident Engineer:**Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-019397**Date Inspected:** 20-Jan-2011**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC)**Location:** Shanghai, China**CWI Name:** Li Yang and Zhu Zhong Hai**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG Trial Assembly**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance (QA) Inspector Mr. S. Manjunath Math was present during the time noted above for observations relative to the work being performed.

This QA Inspector randomly observed the following work in progress:

Orthotropic Box Girder (OBG) at Trial Assembly Areas

Segment 12BW to Segment 12CW (T- Rib Splice weld)

This QA Inspector observed the in-process welding by Shielded Metal Arc Welding (SMAW) process on a Complete Joint Penetration (CJP) groove weld. The Weld joint was designated as SP3041-001-042. The welder identification was 040611 and observed welding in the 4G (Overhead) position using approved Welding Procedure Specification WPS-B-P-2214-B-U2-FCM-1. The piece mark was identified as the Side Panel, T-Ribs at transverse splice, Cross Beam side.

Segment 12BW to Segment 12CW (T- Rib Splice weld)

This QA Inspector observed the in-process welding by Shielded Metal Arc Welding (SMAW) process on a Complete Joint Penetration (CJP) groove weld. The Weld joint was designated as SP3050-001-042. The welder identification was 046709 and observed welding in the 3G (Vertical) position using approved Welding Procedure Specification WPS-B-P-2213-B-U2-FCM-1. The piece mark was identified as the Side Panel, T-Ribs at transverse

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

splice, Counter Weight side.

Segment 12BW to Segment 12CW (I- Rib Splice weld)

This QA Inspector observed the in-process welding by Shielded Metal Arc Welding (SMAW) process on a Complete Joint Penetration (CJP) groove weld. The Weld joint was designated as SP3040-001-037. The welder identification was 057333 and observed welding in the 4G (Overhead) position using approved Welding Procedure Specification WPS-B-P-2214-B-U2-FCM-1. The piece mark was identified as the Side Panel, I-Ribs at transverse splice, Cross Beam side.

Segment 12BW to Segment 12CW (I- Rib Splice weld)

This QA Inspector observed the in-process welding by Shielded Metal Arc Welding (SMAW) process on a Complete Joint Penetration (CJP) groove weld. The Weld joint was designated as SP3039-001-043. The welder identification was 041713 and observed welding in the 4G (Overhead) position using approved Welding Procedure Specification WPS-B-P-2214-B-U2-FCM-1. The piece mark was identified as the Side Panel, I-Ribs at transverse splice, Counter Weight side.

Segment 12BW to Segment 12CW (T- Rib Splice weld)

This QA Inspector observed the in-process welding by Shielded Metal Arc Welding (SMAW) process on a Complete Joint Penetration (CJP) groove weld. The Weld joint was designated as SP3051-001-040. The welder identification was 046709 and observed welding in the 4G (Overhead) position using approved Welding Procedure Specification WPS-B-P-2214-B-U2-FCM-1. The piece mark was identified as the Side Panel, T-Ribs at transverse splice, Counter Weight side.

Please reference the pictures attached for more comprehensive details.


Segment 12BE to Segment 12CE

This QA Inspector observed the repair welding by Shielded Metal Arc Welding (SMAW) process on a Complete Joint Penetration (CJP) groove weld. The Weld joint was designated as OBE12E-003. The welder identification was 040378 and observed welding in the 4G (Overhead) position using approved Welding Procedure Specification WPS-345-SMAW-4G(4F)-Repair-FCM-1. The piece mark was identified as the Transverse splice and Temporary attachment removal area. ZPMC performed repair welding in accordance with Critical Welding Report B-CWR2126.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

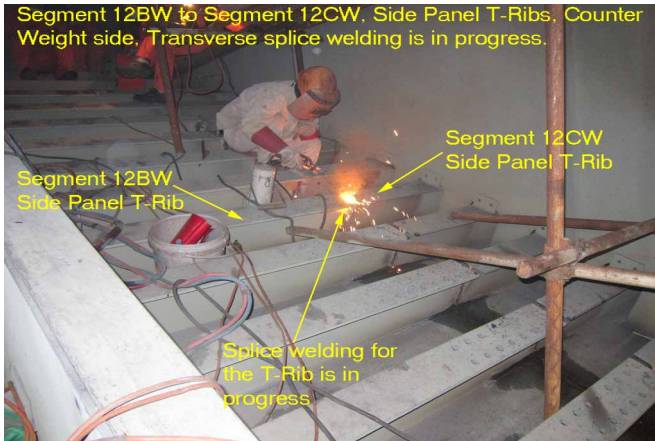

Summary of Conversations:

No relevant conversations were reported on this date.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang 150000422372, who represents the Office of Structural Materials for your project.

Inspected By:	Math,Manjunath	Quality Assurance Inspector
Reviewed By:	Dsouza,Christopher	QA Reviewer
